

3M Fall Protection

Capital Safety Group EMEA
Le Broc Center, Bâtiment A
Z.1. 1re Avenue – BP15
06511 Carros Le Broc, Cedex
France


Telephone: +33 (0) 4 97 10 00 10
Facsimile: +33 (0) 4 93 08 79 70
Website: www.3m.com/fallprotection
E-mail: informationfallprotection@mmm.com

3M™ DBI-SALA COUNTERWEIGHT SYSTEMS (OSHA& CE)**PRODUCT RETROFIT NOTICE**

The 3M™ DBI-SALA Counterweight Systems are composed of a central base unit to accommodate a variety of anchoring options used in Confined Space Rescue. Anchoring options can include a weight rack for counter-balanced applications and a wheel pad assembly to allow the system to be counter-balanced by an attendant vehicle.

3M Fall Protection has determined that certain Counterweight Systems do not fully meet all load claims in all adjustment positions as represented in the “Instruction for Use” (IFU) manual and on product labels. There have been no reported accidents or injuries associated with this issue. This issue only affects the following systems: OSHA P/N’s 8300010, 8511892, 8512894, 8514496, 8520775, 8530088, 8530146, 8530226 8530256, 8530355 & CE P/N’s 8562894, 8564496. **Note, this is not a product recall.**

To address the issue, 3M Fall Protection has developed a design modification to one component common in all Counterweight Systems (center section P/N 8513593 OSHA or 8541688 CE). The modification has been incorporated in all Counterweight Systems manufactured after March 1, 2017, and will be available as a retrofit at no cost to all end users who purchased their systems prior to March 1, 2017.

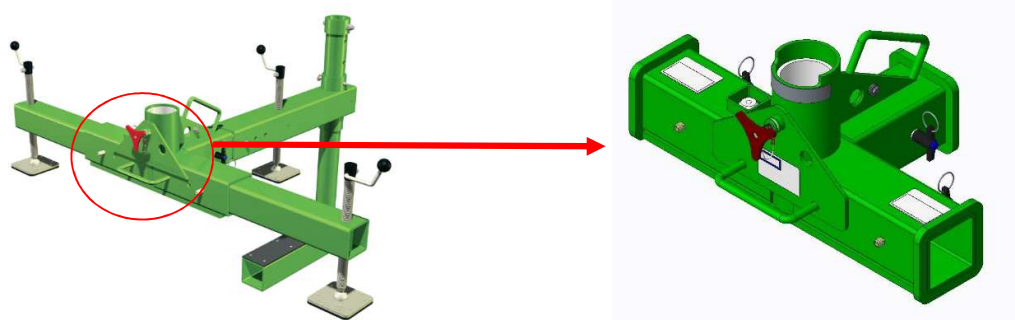

Counterweight System & center section Retrofit Part

End-users: Please contact Customer Service at +33 (0) 4 97 10 00 10 or email informationfallprotection@mmm.com to receive your Retrofit Kit free of charge. Retrofit Kits P/N’s are 8549057 OSHA and 8549058 CE. If you provide us with your contact information, shipping address, and model details of the system you have, we will send you the Retrofit Kit free of charge. When you receive the Retrofit, please follow the instructions for returning your affected center sections using the pre-paid mailing box. Updated IFUs can be found at <http://capitalsafety.webdamdb.com/#folder/2643471>. Please locate the appropriate IFU for your system.

Distributors: If you have any 3M™ DBI-SALA Counterweight Systems in stock that were manufactured prior to March 1, 2017, contact our Customer Service department at +33 (0) 4 97 10 00 10 or email to informationfallprotection@mmm.com to obtain your Retrofit Kit. Please forward this Retrofit Notice to any of your customers who have purchased affected Systems from you and provide any assistance requested by your customers to complete the retrofit process. If you have not received our sales history to you, please email or call us at +33 (0) 4 97 10 00 10 or email informationfallprotection@mmm.com.

October 17, 2017